

GROUP 3 POWER TRAIN

| Trouble | Probable cause | Remedy |
|--|--|---|
| Final drive noisy | <ul style="list-style-type: none"> · No or low lubricating oil level · Axles too much endplay · Locking pin not inserted in wheel axles | <ul style="list-style-type: none"> · Remove oil level check plug from the drive housing. If oil does not flow from it, oil level is low and some must be added. · Preload axle bearings removing all endplay. · Inspect and adjust or replace damaged parts. |
| No drive on one side | <ul style="list-style-type: none"> · Drive chain failure | <ul style="list-style-type: none"> · Inspect chain and connection link. Replace damaged parts. |
| Travel hydraulic system failure | <ul style="list-style-type: none"> · Travel motor shaft or key failure | <ul style="list-style-type: none"> · Inspect and replace damaged parts. Refer to travel hydraulic circuits. |